2019 - 2020 Cadillac CT6-V: Service Bulletin: #19-NA-275: Moan Type Noise Heard During Low Speed Maneuvers - (Sep 29, 2020)

#19-NA-275: Moan Type Noise Heard During Low Speed Maneuvers - (Sep 29, 2020)

Subject:				Moan Type Noise Heard During Low Speed Maneuvers			
Brand:	Model:	Model Y	ear:	Breakpoint:		Engine:	Transmis
		from	to	from	to		sion:
Cadillac	CT6-V	2019	2020		_	4.2L	_
						(RPO	
						LTA)	

Involved Region or CountryNorth America, Middle EastAdditional Options (RPOs)Equipped with BRAKE LINING-
PERFORMANCE DRIVING (RPO

JE2)

Condition Some customers may comment on a

moan type noise being heard during

low speeds maneuvers.

Note: This noise is most likely to be heard during light brake pedal pressure

and/or releasing the brake pedal.

Cause This condition may be caused by the

high performance track-capable brake

lining generating high brake torque

during a brake event.

Correction

If the noise concern on the vehicle matches the sound in the audio file shown above, replace the upper

control arms. Refer to Upper Control

Arm Replacement in SI.

Parts Information

Causal Part	Description	Part Number	Qty
X	UPPER	84836699	1
	CONTROL		
	ARM DRIVER		
	SIDE		
	UPPER	84836698	
	CONTROL		
	ARM		
	PASSENGER		
	SIDE		

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation Description Labor Time
8033030 Upper Control Arm Use Published Labor
Replacement Operation Time

Version 1

Modified Released September 29, 2020

Online URL:

https://www.cadillacvnet.com/knowledge-base/article/2019-2020-cadillac-ct6-v-service-bulletin-19-na-275-moan-type-noise-heard-during-low-speed-maneuvers-sep-29-2020-35.html