

# 2020 - 2021 Cadillac CT5-V: Service Bulletin: #PIP5763: Service Rear Axle Message with DTC C1135 SYM92 - (Nov 13, 2020)

## #PIP5763: Service Rear Axle Message with DTC C1135 SYM92 - (Nov 13, 2020)

**Subject:** Service Rear Axle Message with DTC  
C1135 SYM92

Brand:	Model:	Model Year:	VIN:	Engine:	Transmi ssion:
		from to	from to		
Cadillac	CT5-V	2020 - 2021	ALL ALL	LGY	MHS

***Involved Region or Country*** North America

**Additional Options (RPO)** RPO G96 Differential, Electronic  
Limited Slip

***Condition*** Some customers may comment that  
there is a Service Axle message  
displayed and possible loss of limited  
slip differential function.

***Cause*** This condition occurs when C1135  
symptom byte 92 is set in the K164  
Differential Control Module (DCM)

## Correction

Engineering has identified a software anomaly that causes the DTC to  
set prematurely. If code C1135.92 is in History, clear codes using  
GDS2 and take no further action. Do not replace the K164

## Differential Control Module.

A revised calibration will be available in the December 2020 timeframe to address this condition.

A Bulletin will be released to replace this PI when the calibration is available

**Note:** If the DTC is Current, continue with published Service Information diagnostics.

*Version* 1

*Modified* 11-13-2020 – Created on.

Online URL:

<https://www.cadillacvnet.com/knowledge-base/article/2020-2021-cadillac-ct5-v-service-bulletin-pip5763-service-rear-axle-message-with-dtc-c1135-sym92-nov-13-2020-43.html>