

# 2020 - 2021 Cadillac CT5-V: #PIP5763A: Service Rear Axle Message with DTC C1135 SYM92 - (Jan 26, 2021)

## #PIP5763A: Service Rear Axle Message with DTC C1135 SYM92 - (Jan 26, 2021)

<b>Subject:</b>	Service Rear Axle Message with DTC C1135 SYM92				
<b>Brand:</b>	<b>Model:</b>	<b>Model Year:</b>	<b>VIN:</b>	<b>Engine:</b>	<b>Transmission:</b>
		from      to	from      to		
Cadillac	CT5-V	2020 - 2021	ALL	ALL	LGY      MHS
<b>Involved Region or Country</b>		North America			
<b>Additional Options (RPO)</b>		RPO G96 Differential, Electronic Limited Slip			
<b>Condition</b>		Some customers may comment that there is a Service Axle message displayed and possible loss of limited slip differential function			
<b>Cause</b>		This condition occurs when C1135 symptom byte 92 is set in the K164 Differential Control Module (DCM)			
<b>Correction</b>					

Engineering has identified a software anomaly that causes the DTC to set prematurely. If code C1135.92 is in History, clear codes using

GDS2 and take no further action. Do not replace the K164 Differential Control Module.

A revised calibration is expected to be available in the first quarter of 2021 to address this condition.

A Bulletin will be released to replace this PI when the calibration is available

**Note:** If the DTC is Current, continue with published Service Information diagnostics.

<i>Version</i>	2
<i>Modified</i>	11-13-2020 - Created on.
	01/26/2021 - Updated expected time calibration will be available to first quarter of 2021.

Online URL:

<https://www.cadillacvnet.com/knowledge-base/article/2020-2021-cadillac-ct5-v-pip5763a-service-rear-axle-message-with-dtc-c1135-sym92-jan-26-2021-51.html>