

2020 - 2021 Cadillac CT5-V: Service Bulletin: #PIP5763B: Service Rear Axle Message with DTC C1135 SYM92 - (Feb 17, 2021)

#PIP5763B: Service Rear Axle Message with DTC C1135 SYM92 - (Feb 17, 2021)

Subject: Service Rear Axle Message with DTC C1135 SYM92

Brand:	Model:	Model Year:	from	to	VIN:	from	to	Engine:	Transmi	ssion:
Cadillac	CT5-V	2020 - 2021			ALL	ALL		LGY	MHS	

Involved Region or Country

North America

Additional Options (RPO)

RPO G96 Differential, Electronic
Limited Slip

Condition

Some customers may comment that
there is a Service Axle message
displayed and possible loss of limited
slip differential function.

Cause

This condition occurs when C1135
symptom byte 92 is set in the K164
Differential Control Module (DCM)

Correction

Engineering has identified a software anomaly that causes the DTC to set prematurely. If code C1135.92 is in History, clear codes using

GDS2 and take no further action. Do not replace the K164 Differential Control Module.

After clearing the DTC, the vehicle is safe to drive and can be returned to the customer.

A revised calibration is expected to be available in the first quarter of 2021 to address this condition.

A Bulletin will be released to replace this PI when the calibration is available

Note: If the DTC is Current, continue with published Service Information diagnostics.

<i>Version</i>	3
<i>Modified</i>	11/13/2020 - Created on.
	01/26/2021 - Updated expected time calibration will be available to first quarter of 2021.
	02/17/2021 - Updated to add vehicle is safe to drive and can be returned to customer after DTC is cleared.

Online URL:

<https://www.cadillacvnet.com/knowledge-base/article/2020-2021-cadillac-ct5-v-service-bulletin-pip5763b-service-rear-axle-message-with-dtc->

[c1135-sym92-feb-17-2021-54.html](#)