

2021 Cadillac CT4 RWD L4-2.0L Turbo


Vehicle > Heating and Air Conditioning > Control Assembly > Service and Repair > Removal and Replacement > HVAC - Automatic

## HEATER AND AIR CONDITIONING USER INTERFACE CONTROL REPLACEMENT


**Document ID: 5482921**

### Removal Procedure

1. With a flat bladed plastic trim tool, start at the top to release the clip.

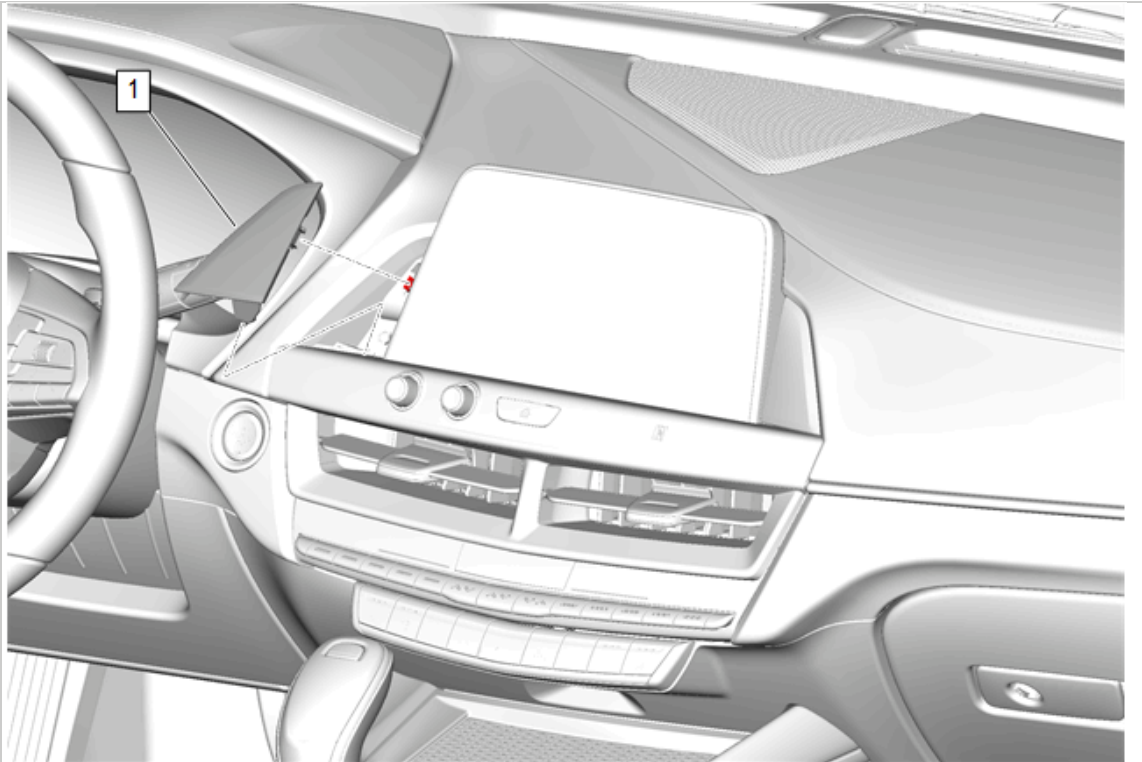


2. Instrument Panel Radio Front Trim Plate (1) » Remove
3. With a flat bladed plastic trim tool, start at the top to release the clip.

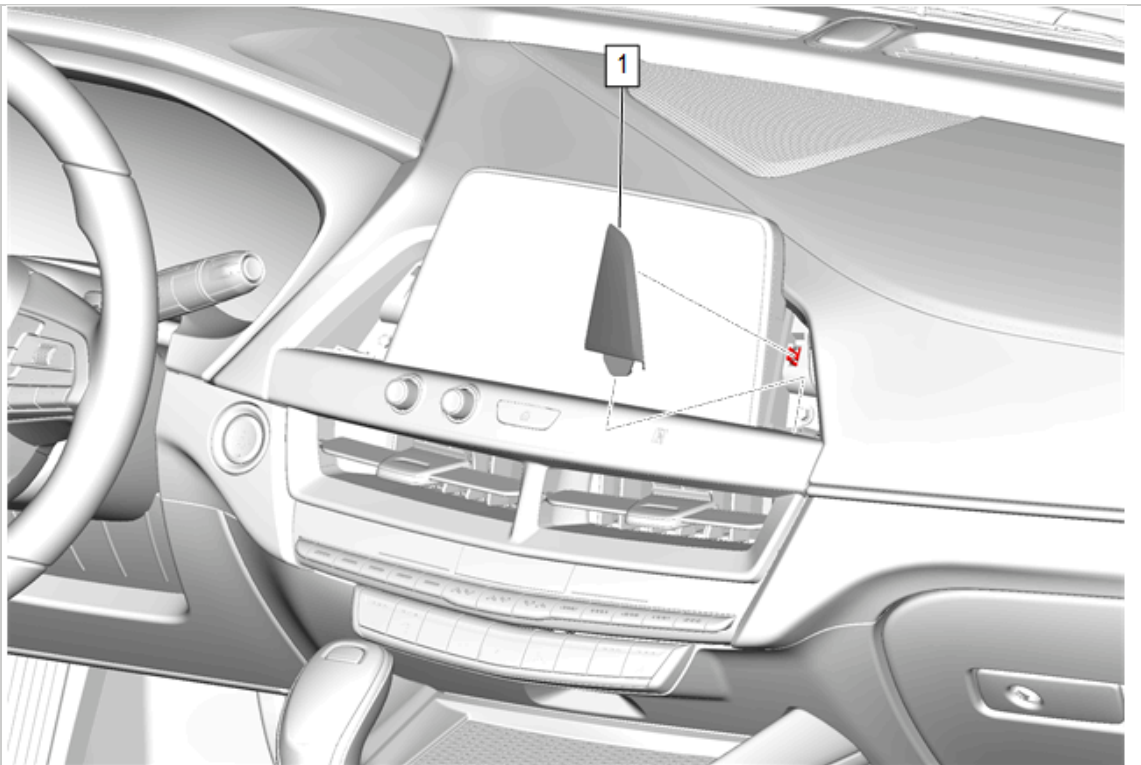

4. Instrument Panel Radio Front Trim Plate (1) » Remove


5. Radio Control Bolt (1) » Remove [2x]

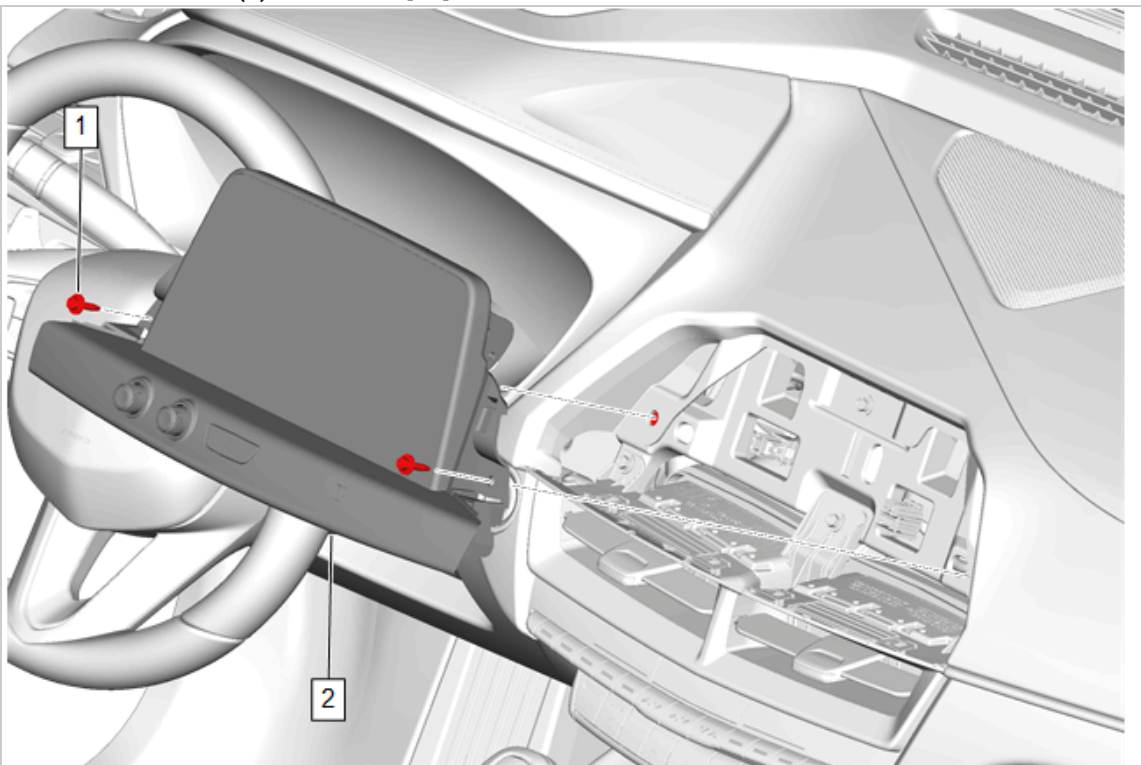

6. Disconnect the electrical connectors.


7. Radio Control (2) » Remove

8. Instrument Panel Center Air Outlet Bolt (1) » Remove [3x]

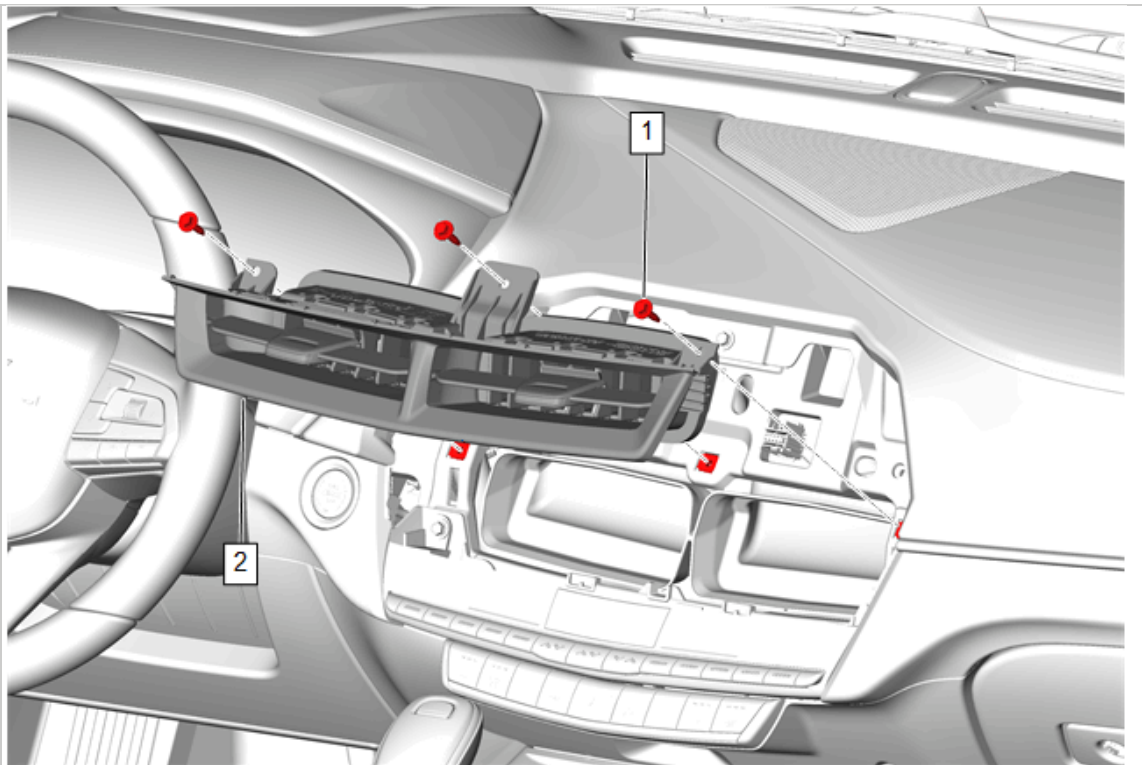

9. Instrument Panel Trim Plate (2) » Remove

10. Heater and Air Conditioning Control Bolt (1) » Remove [2x]

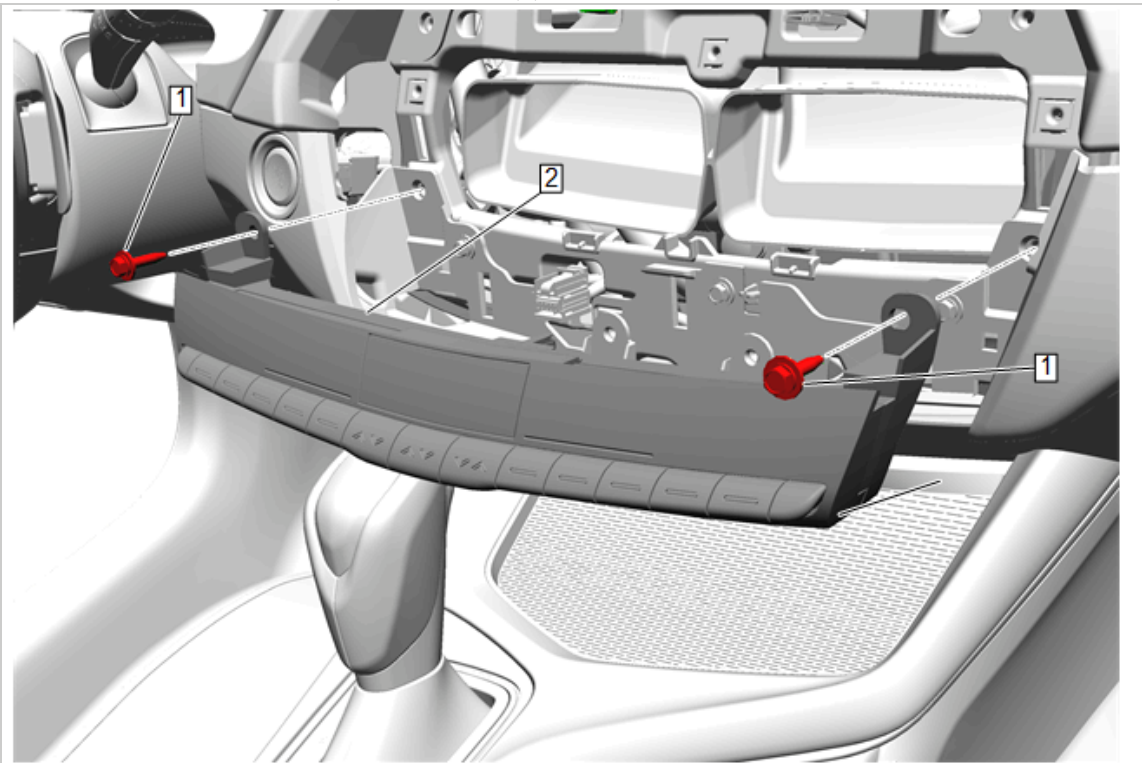


11. Heater and Air Conditioning User Interface Control (2) » Remove

12. Disconnect the electrical connector.

## Installation Procedure

1. Connect the electrical connector.


## 2. Heater and Air Conditioning User Interface Control (2) » Install

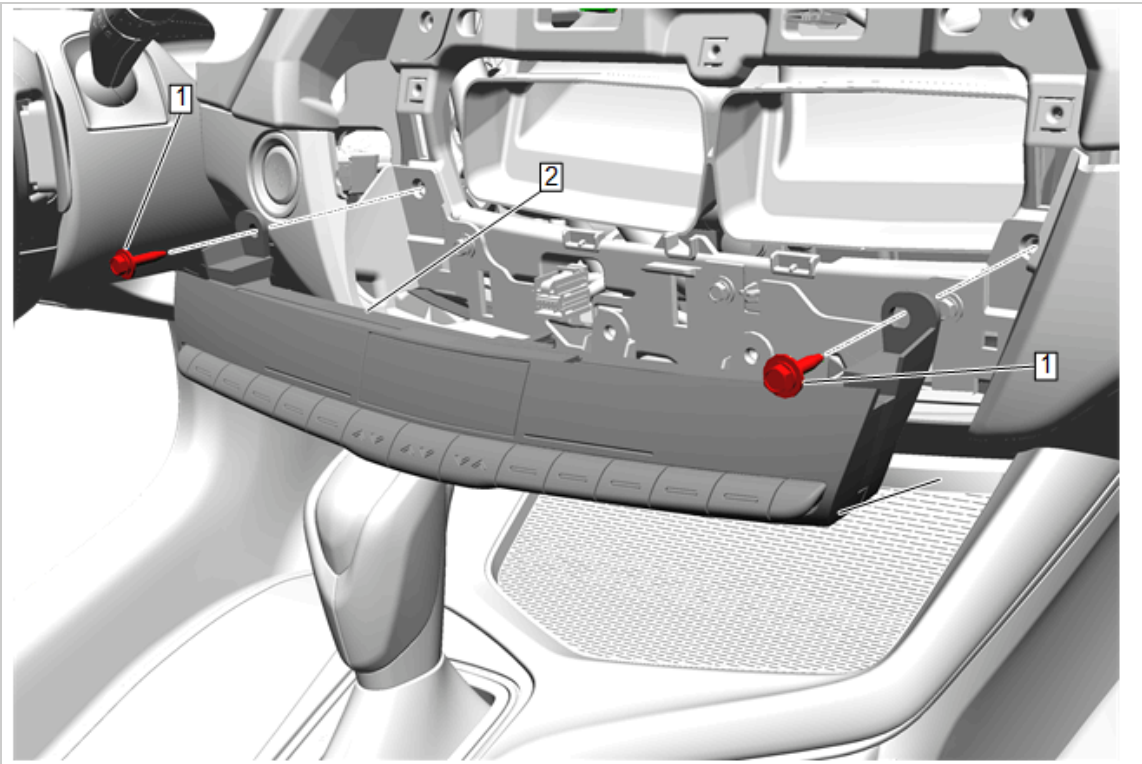

**Caution:** Refer to Fastener Caution.

## 3. Heater and Air Conditioning Control Bolt (1) » Install and tighten [2x] – Fastener Specifications

## 4. Instrument Panel Trim Plate (2) » Install

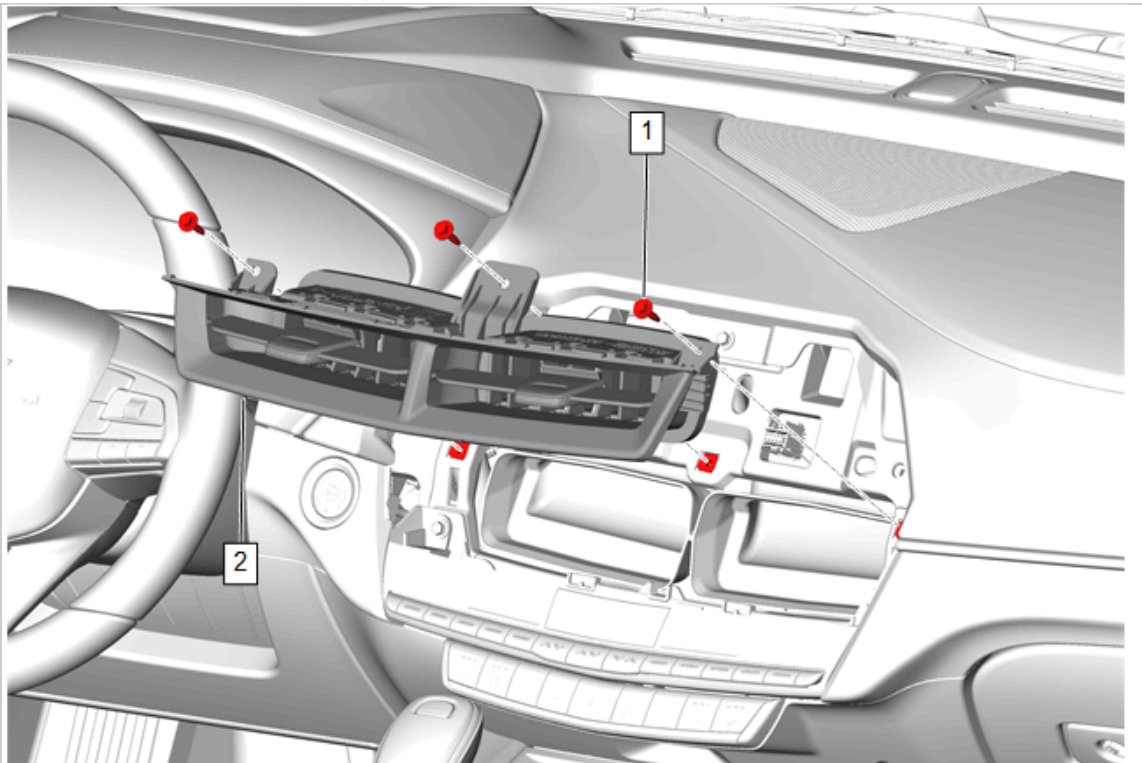


## 5. Instrument Panel Center Air Outlet Bolt (1) » Install and tighten [3x] – Fastener Specifications

## 6. Connect the electrical connectors.


## 7. Radio Control (2) » Install



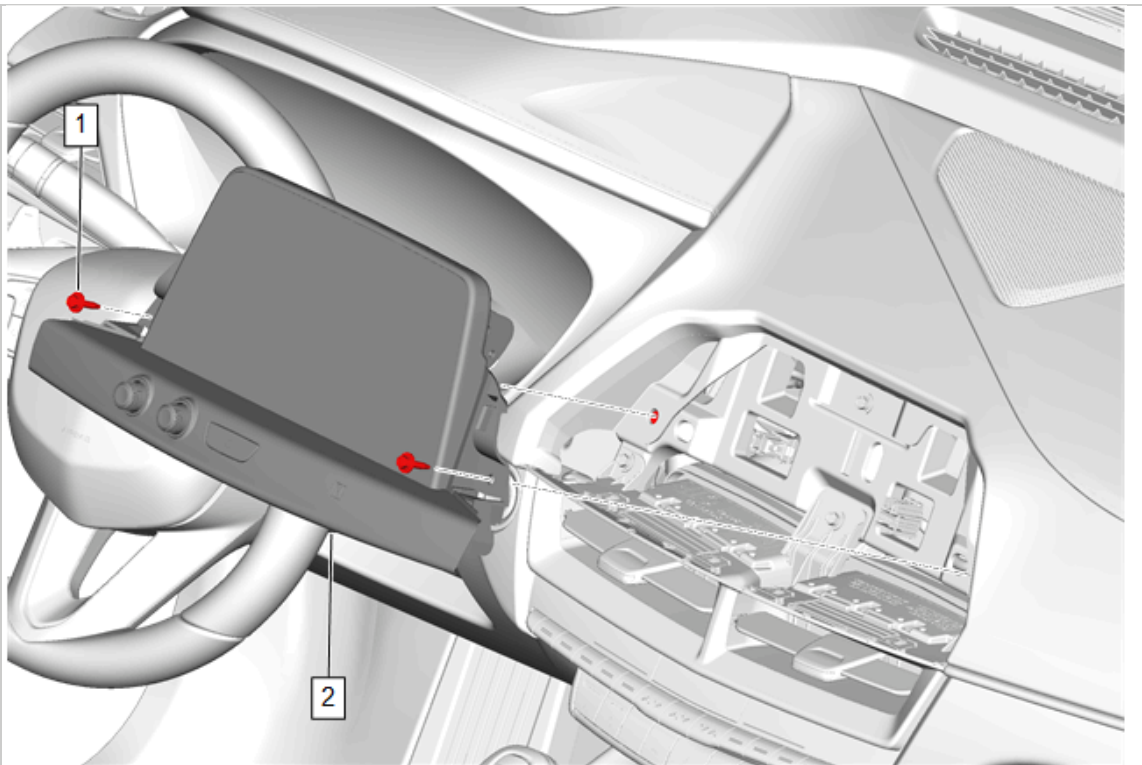

8. Radio Control Bolt (1) » Install and tighten [2x] — Fastener Specifications

9. Instrument Panel Radio Front Trim Plate (1) » Install

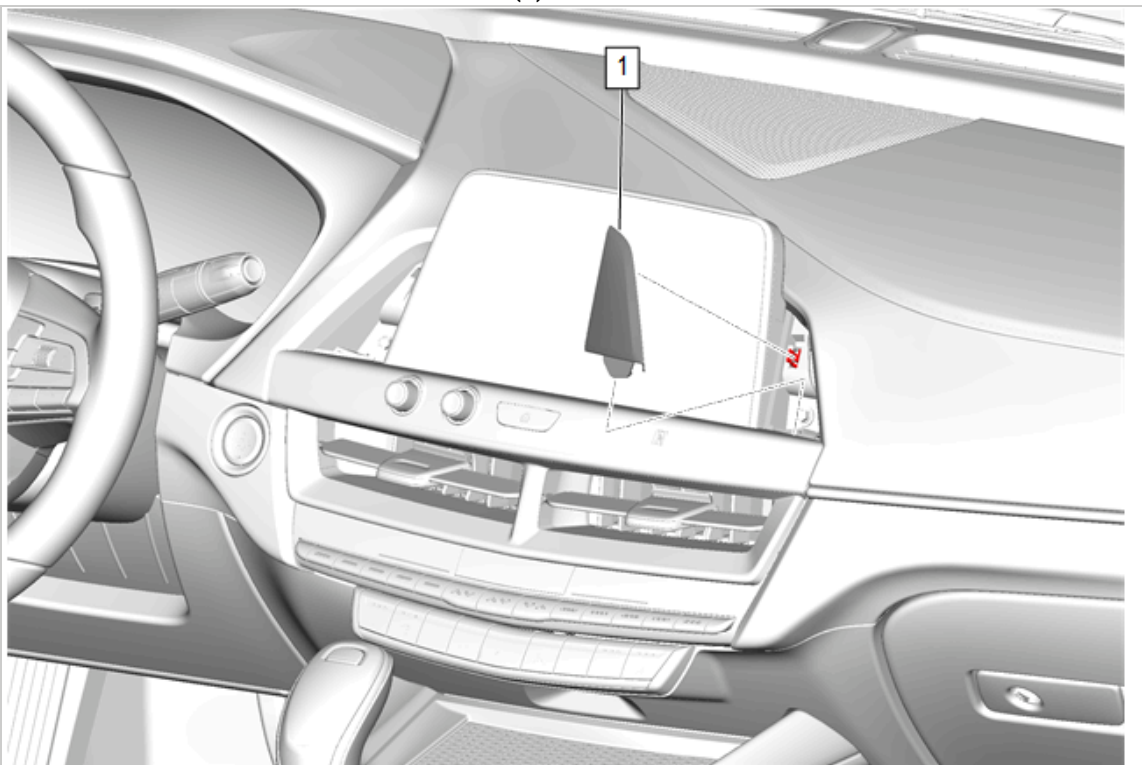

10. Instrument Panel Radio Front Trim Plate (1) » Install

