

2021 Cadillac CT5 RWD L4-2.0L Turbo


Vehicle > Heating and Air Conditioning > Control Assembly > Service and Repair > Removal and Replacement > HVAC - Automatic

## HEATER AND AIR CONDITIONING USER INTERFACE CONTROL REPLACEMENT


**Document ID: 5324526**

### Removal Procedure


1. Instrument Panel Instrument Cluster Hood (1) » Remove — Instrument Panel Instrument Cluster Hood Replacement

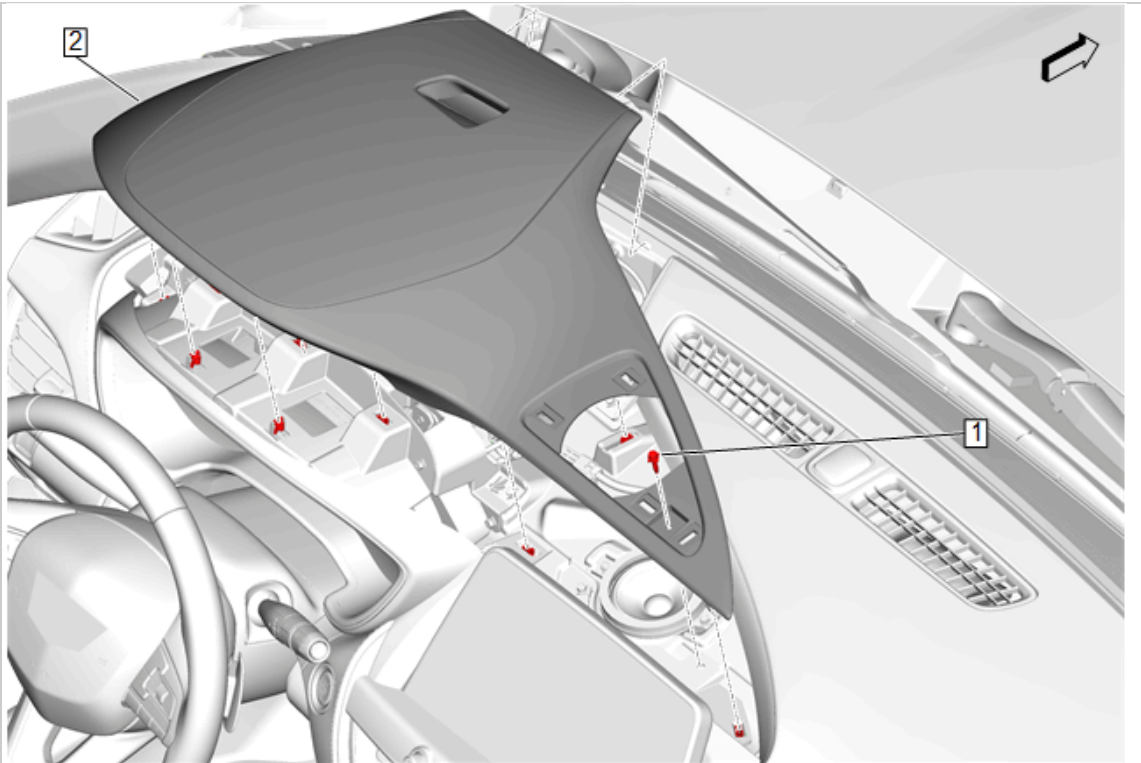


2. Radio Control (2) » Remove — Radio Control Replacement

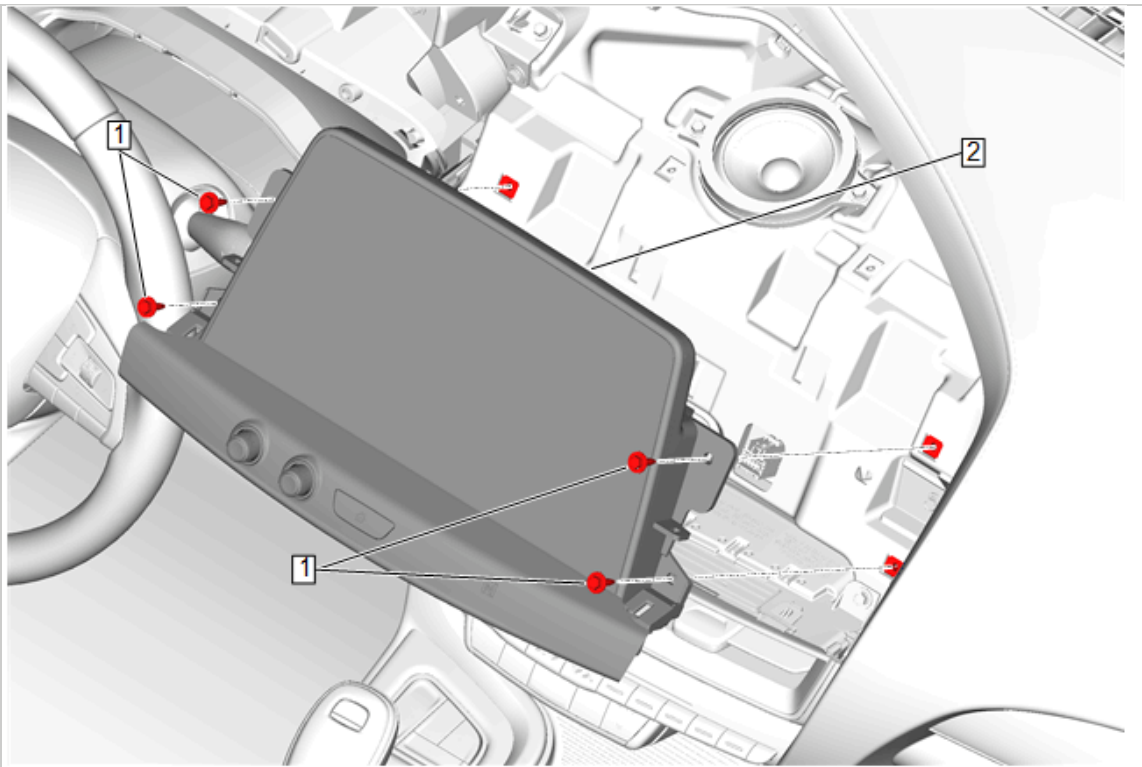

3. Instrument Panel Center Air Outlet (2) » Remove – Instrument Panel Center Air Outlet Replacement

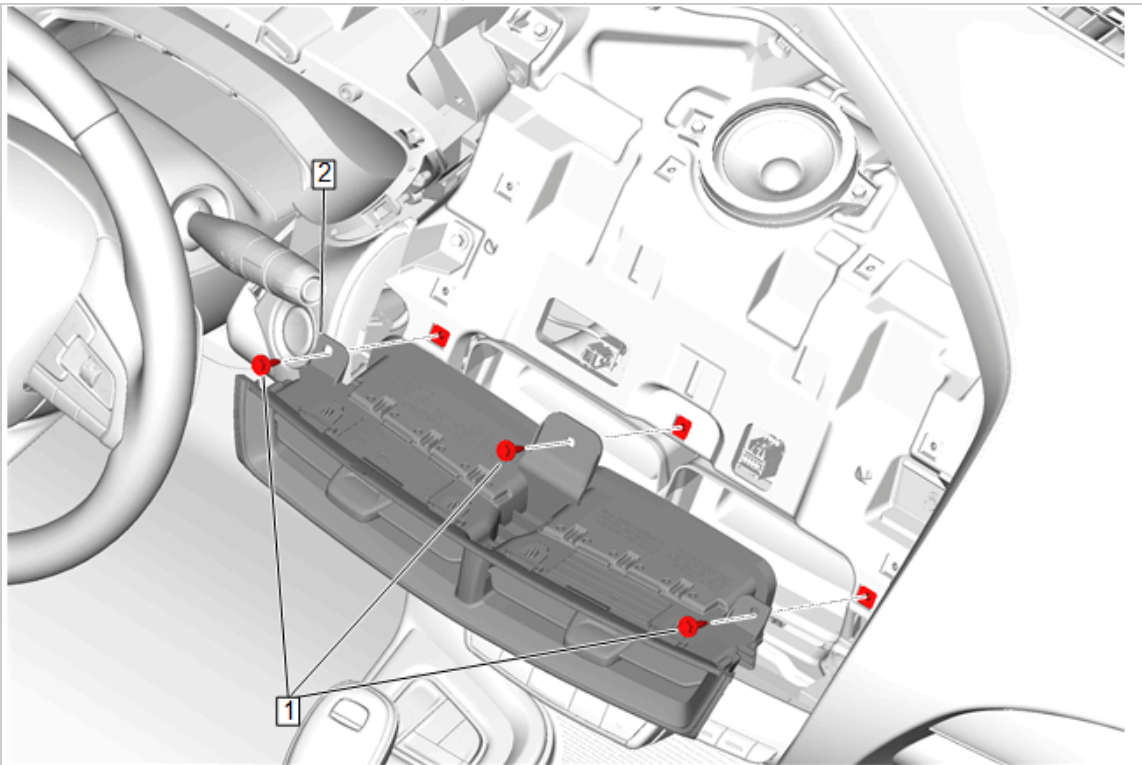

4. Heater and Air Conditioning Control Bolt (1) » Remove [2x]

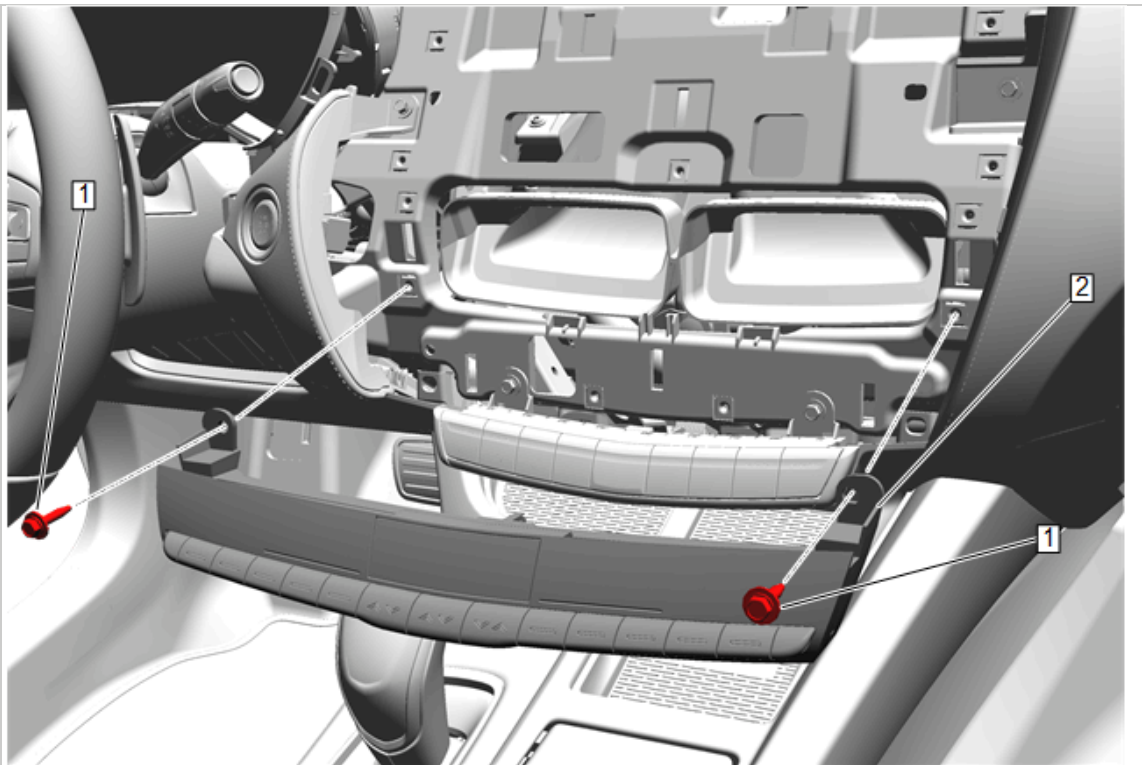


5. Heater and Air Conditioning User Interface Control (2) » Remove

6. Disconnect the electrical connector.

## Installation Procedure

1. Connect the electrical connector.

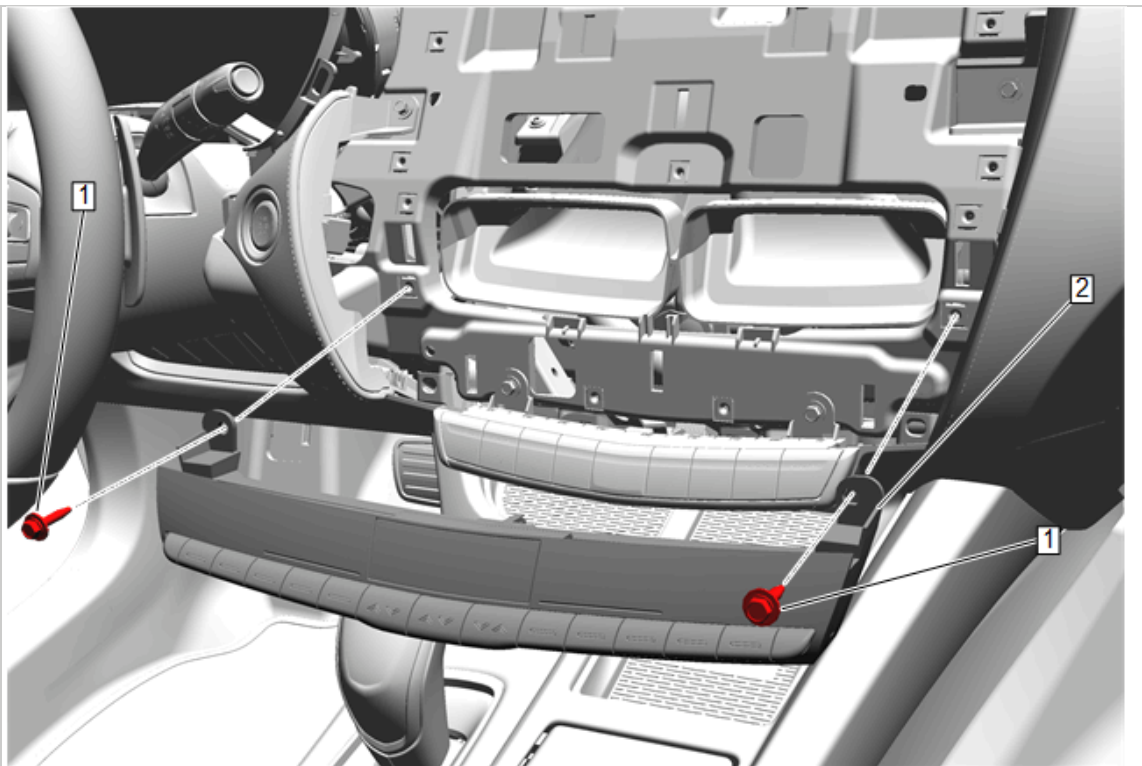


2. Heater and Air Conditioning User Interface Control (2) » Install


**Caution:** Refer to Fastener Caution.

3. Heater and Air Conditioning Control Bolt (1) » Install and tighten [2x] **2.5 Nm (22 lb in)**

4. Instrument Panel Center Air Outlet (2) » Install – Instrument Panel Center Air Outlet Replacement

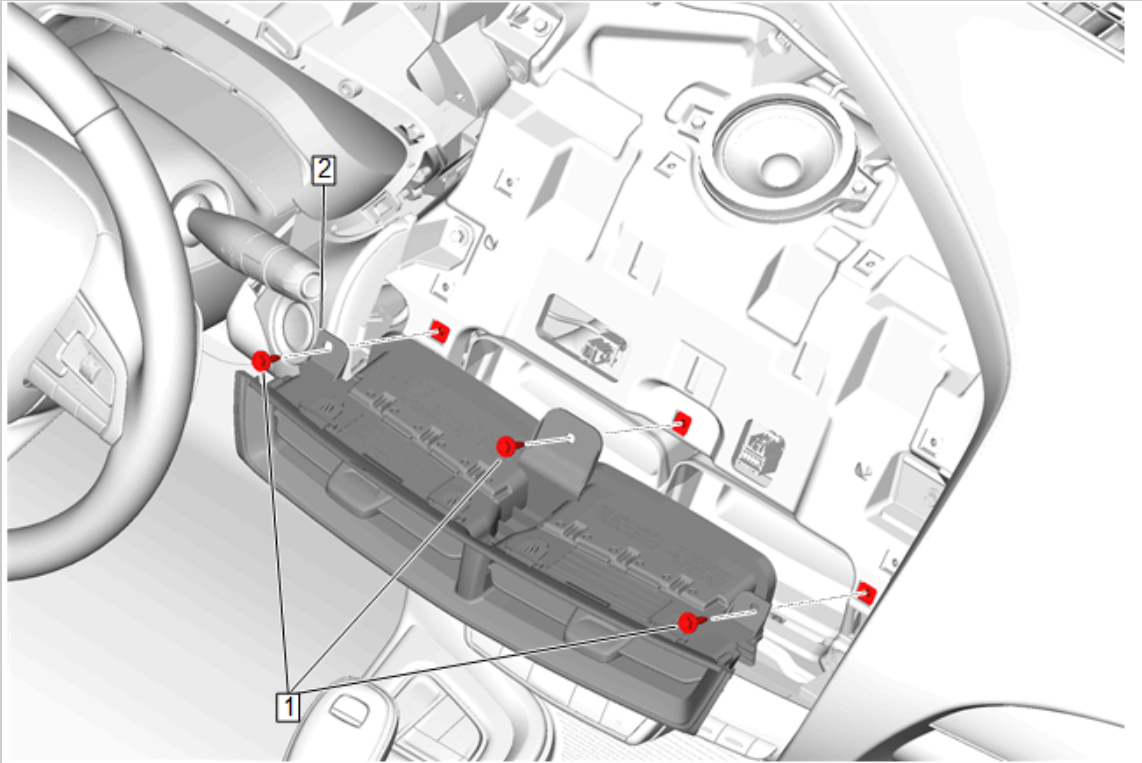


5. Radio Control (2) » Install – Radio Control Replacement

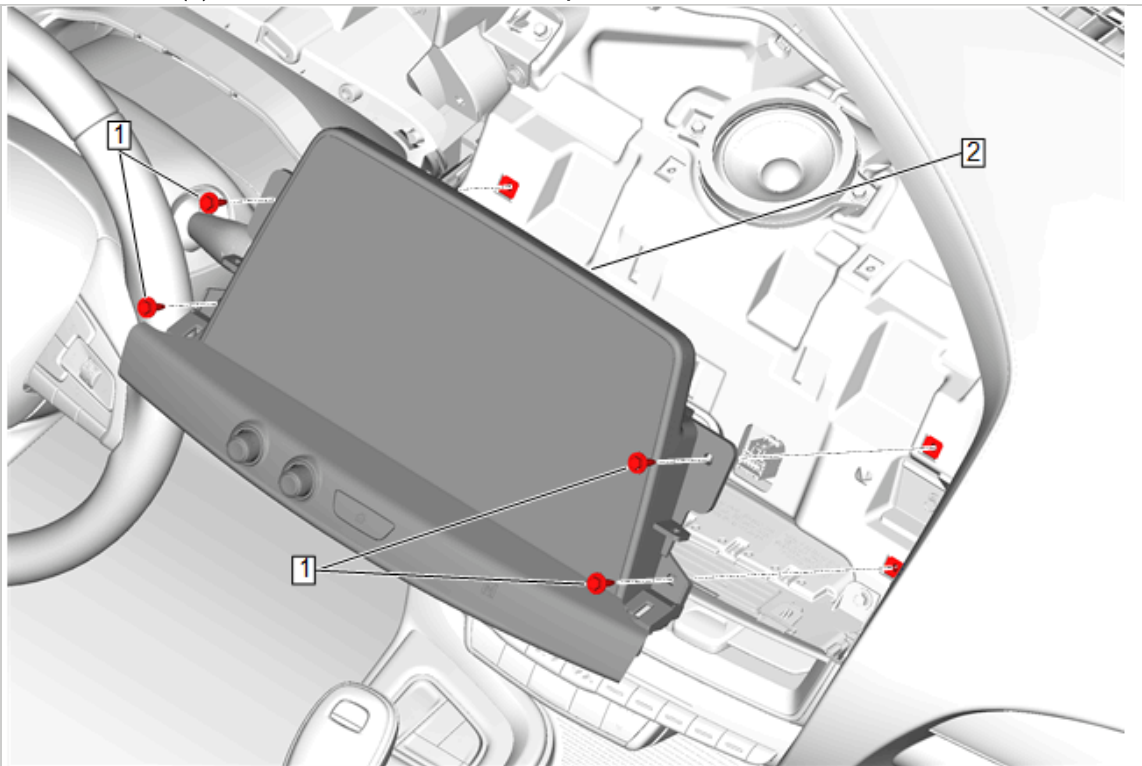

6. Instrument Panel Instrument Cluster Hood (1) » Install – Instrument Panel Instrument Cluster Hood Replacement



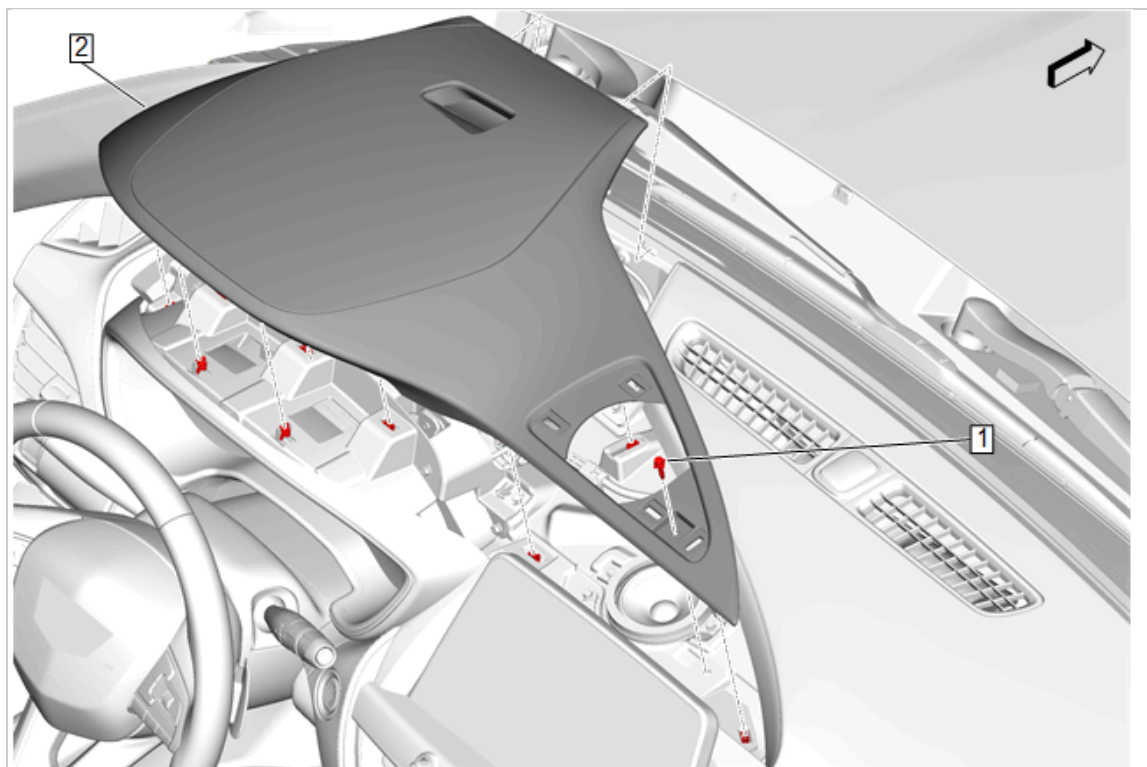

7. Clear the DTCs from the heater and air conditioning remote control module.