## 2016 - 2018 Cadillac ATS-V CTS-V: Service Bulletin: #16-NA-059: Staining/Discoloring to Brake Caliper Paint - (Oct 14, 2020)

## #16-NA-059: Staining/Discoloring to Brake Caliper Paint - (Oct 14, 2020)

Subject:	Staining/Discoloring to Brake Caliper
	Paint

				Pallit			
<b>Brand</b> :	Model:	Model Y	ear:	VIN:		<b>Engine</b> :	Transmi
		from	to	from	to		ssion:
Cadillac	ATS-V	2016	2018			All	All
	CTS-V	2016	2018				
Chevrole	Camaro	2012	2021				
t	Corvette	2014	2020				

Involved Region or Country

North America, Europe, Russia, Middle East, Israel, Argentina, Brazil, Bolivia, Chile, Colombia, Ecuador, Paraguay, Peru, Uruguay, Japan, GM Korea Company, China, Taiwan, Philippines

**Condition** 



Cause


Some customers may comment on a discoloration or black stain on the paint of the brake calipers.

This may be caused by high brake pad temperatures during aggressive driving or track event tarnishing the caliper paint.

## Correction

**Important:** Do *NOT* replace the brake calipers for this condition.

This is not a defect in the paint or the caliper.

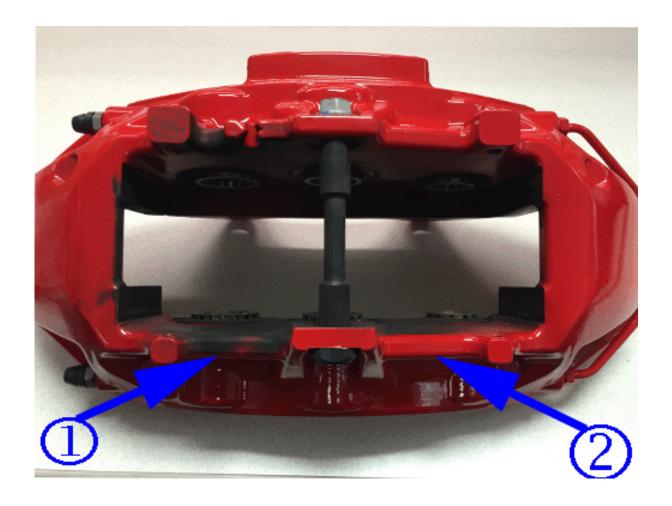

(1)	Not cleaned using mild polishing
	compound
(2)	Cleaned using mild polishing
	compound

If the customer wishes to have the black stain removed, a very mild polishing compound can be used to remove the stain.

Important: Do NOT use harsh chemicals or brake cleaner to attempt

to remove the stain. This could damage the paint on the caliper.

Version Modified 3 May 30, 2017 – Updated the Models and Model Years.

October 14, 2020 – Updated the Models, Model Years and updated formatting to remove Attention statement and add the Involved Region or Country section.

## Online URL:

https://www.cadillacvnet.com/knowledge-base/article/2016-2018-cadillac-ats-v-cts-v-service-bulletin-16-na-059-staining-discoloring-to-brake-caliper-paint-oct-14-2020-39.html